

APPLICATION INSTRUCTIONS



1

Prepare application area thoroughly by removing all sand, dirt, chemicals and oily substances.



2

Using a suitable propane torch, remove all moisture present (if any) and preheat the area prior to treatment.



3

Remove the packaging and carefully place the Road Master overbanding tape on the road surface with the top facing up. Position the tape as accurately over the crack for optimum performance. Cut to size.



4

Heat the Road Master overbanding tape using a suitable propane torch, keeping the flame approximately 200-300mm from the tape. With a side to side motion, ensuring evenly distributed heat, heat the material gently until molten and it begins to bubble slightly and flow into the surface. Ensure both surfaces are fused together.



5

Leave the Road Master overbanding tape to cool and harden for 15 minutes. When cool, examine the tape and test by trying to lift it using a metal spatula or knife. If areas do lift, repeat step 4.

Notes: Suitable for cracks less than 5mm wide and 20mm deep